


MONUMENT RECORD

Corner ID: **Per_Q07**

Quarter Corner


Sections 10 & 11- T08N-R01W, 2nd P.M.

Perry Township, Monroe County, Indiana

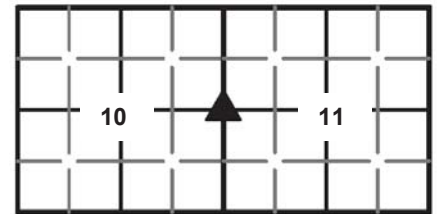

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)
5" x 5" cut limestone with cut "+" found 1.2' above grade.

MONUMENT LOCATION SKETCH:

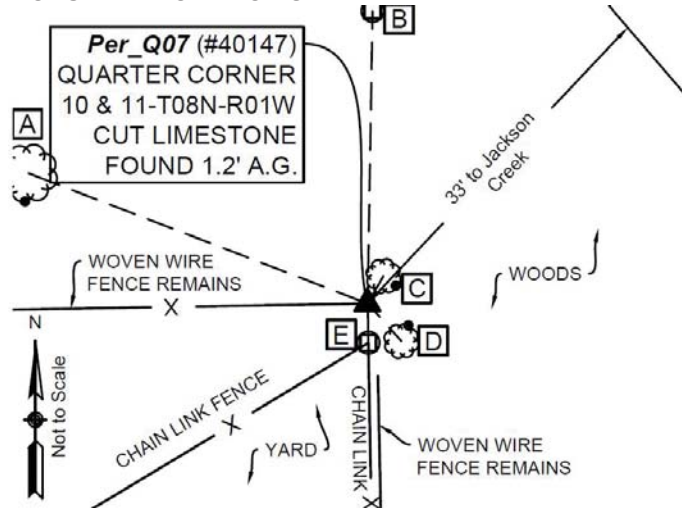

WITNESS MONUMENT TIES: Describe at least three new BT's and/or witness objects established or work done to preserve existing evidence. All ties to new Bearing Trees (BTs) are a mag nail set in a 1-1/2" plastic washer stamped "SURVEY MARKER - DO NOT REMOVE" and hack mark at the root crown (less than 12" above ground) perpendicular to the center of the tree, unless otherwise noted. BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail. Distances to witness ties were measured with a Leica Disto laser distance meter. Bearings are shown approximately per 2017 aerial imagery and compass readings.

ID	Bearing	Distance	Description
A	N 69° W	32.3'	Mag nail and washer set 1.6' above grade in hack on the south side of a 32" cottonwood
B	N 1° E	26.0'	T-post
C	N 30° E	2.8'	Mag nail and washer set 1.0' above grade in hack on the southeast side of a 5" tight-bark hickory
D	S 42° E	4.5'	Mag nail found 1.0' above grade in the northeast side of a 12.5" hackberry
E	S 1° E	3.5'	3" dia. chain link fence post

PHOTO IDENTIFIED: Photo Date: 03/23/2018



Photo Orientation & Description: Looking southeast at Per_Q07



Photo Orientation & Description: Looking south at Per_Q07



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 1 of 4

MONUMENT RECORD

Corner ID: **Per_Q07**

Quarter Corner

Sections 10 & 11- T08N-R01W, 2nd P.M.
Perry Township, Monroe County, Indiana

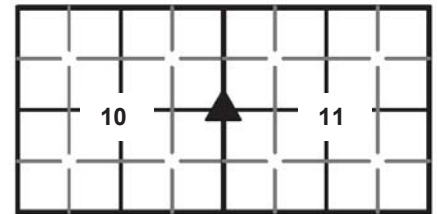


Photo Orientation & Description: Looking west at Per_Q07



Photo Orientation & Description: Looking north at Per_Q07

EXISTING SURVEY HISTORY Include as much detail and history of the corner as known at the time of perpetuation

ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: 1815 By: Arthur Henrie

Where filed or recorded: MCSO GLO Book, page 49

Original monument: 1/4 section post

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
Sugar	8"	S 50° E	21 lks
Ironwood	5"	N 30° E	5 lks

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: 11/5/1856 By: James Spencer, MCS

Where filed or recorded: MCSO LSB 1, pg 309

Original monument: Corner is depicted on sketch, but is not mentioned in the survey.

OTHER SURVEY HISTORY: Include details such as surveyor name, date, recording info, monument description, etc.

Date	RSID	Surveyor	Description	Source	Cabinet/Book	Pg	InstNo
	003050	Graham, Raymond	Collier, Tracts 1-3	Auditor's Office	Survey Drawers (Auditor)		
	003057	Unknown	Bittner Woods. Corner ID hard to read.	Auditor's Office	Survey Drawers (Auditor)		
11/5/1856	003019	Spencer, James	Legal Survey in 9 & 10	Surveyor's Office	MCSO Survey Book 1	309	
12/8/1978	002947	Graham, Raymond	0.61 acre survey	Surveyor's Office	Township Drawers (Surveyor)		
12/9/1978	002948	Graham, Raymond	0.96 acre survey	Surveyor's Office	Township Drawers (Surveyor)		
6/21/1985	002992	Smith, Stephen L.	Hyde Park Subd. Section 1	Recorder's Office	Plat Book 7	198	1985173395.IN
7/12/1985	003068	Smith, Stephen L.	Hyde Park Subd. Boundary Survey	Auditor's Office	Survey Drawers (Auditor)		
7/19/1985	002993	Graham, Raymond	Suzanne Miller Add.	Recorder's Office	Plat Cabinet B	304	1985175786.IN
8/15/1985	002996	Smith, Stephen L.	Hyde Park Section II Phase I	Recorder's Office	Plat Book 7	17	1985177199.IN
8/30/1985	002994	Smith, Stephen L.	Hyde Park Subd. Section 2	Recorder's Office	Plat Book 7	211	1985176470.IN
9/27/1985	002943	Smith, Stephen L.	Hyde Park Subd. Section III	Recorder's Office	Plat Cabinet B	306	176471
9/27/1985	002995	Smith, Stephen L.	Hyde Park Subd. Section 3	Recorder's Office	Plat Book 7	213	1985176471.IN



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us


Page 2 of 4

MONUMENT RECORD

Corner ID: **Per_Q07**

Quarter Corner

Sections 10 & 11- T08N-R01W, 2nd P.M.
Perry Township, Monroe County, Indiana

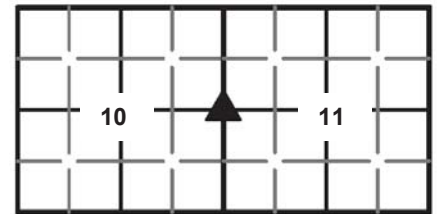

12/2/1985	002997	Smith, Stephen L.	Hyde Park Subd. Section 4	Recorder's Office	Book 8	6	1986179943.IN
4/5/1986	002998	Smith, Stephen L.	Somerset East	Recorder's Office	Book 8	34	1986185319.IN
4/5/1986	003000	Smith, Stephen L.	Hyde Park Subd. Sec 6	Recorder's Office	Book 8	35	1986185936.IN
7/2/1986	003001	Smith, Stephen L.	Hyde Park Subd. Section 7	Recorder's Office	Book 8	51	1986189809.IN
7/16/1986	003058	Utt, Lee	0.61 acre survey	Auditor's Office	Survey Drawers (Auditor)		
9/25/1986	003002	Smith, Stephen L.	Hyde Park Subd. Section 8	Recorder's Office	Book 8	59	1986191484.IN
1/29/1987	003003	Smith, Stephen L.	Hyde Park Subd. Section 5	Recorder's Office	Book 8	119	1987207230.IN
10/23/1987	003004	Bledsoe, Ben E.	Hyde Park Subd. Section 11	Recorder's Office	Book 8	135	1987209408.IN
10/23/1987	003005	Bledsoe, Ben E.	Hyde Park Subd. Section 10	Recorder's Office	Book 8	137	1987209409.IN
12/2/1988	003006	Bledsoe, Ben E.	Hyde Park Subd. Section 12 Amended	Recorder's Office	Plat Cabinet B	373	1988814436.IN
8/9/1989	002989	Bledsoe, Ben E.	Hunters Glen Subd.	Recorder's Office	Plat Cabinet B	268	914963
11/29/1989	003054	Bledsoe, Ben E.	Hunters Glen Lot 7 Add.	Auditor's Office	Survey Drawers (Auditor)		
1/24/1990	003047	Bledsoe, Ben E.	Howards House- Hyde Park, Section 1, 8.11 acres.	Auditor's Office	Survey Drawers (Auditor)		
5/17/1990	003063	Bledsoe, Ben E.	Hyde Park Section 1	Auditor's Office	Survey Drawers (Auditor)		
6/13/1990	003007	Bledsoe, Ben E.	Kensington Subd.	Recorder's Office	Plat Cabinet C	1	1990008220.IN
2/5/1992	002951	Bledsoe, Ben E.	Hyde Park Section 13, Phase 1	Recorder's Office	Plat Cabinet C	40	210401
8/29/1992	002952	Smith, Stephen L.	Hyde Park, Section 13 Phase II	Recorder's Office	Plat Cabinet C	50	216700
3/30/1993	002941	Bledsoe, Ben E.	Owens Property, 4.486 acre survey	Recorder's Office	Survey Book 2	308	304631
3/30/1993	003061	Bledsoe, Ben E.	Owens Property	Auditor's Office	Survey Drawers (Auditor)		

The origin of the stone is unknown. It was first mentioned in the Monroe County Survey records on the 1985 boundary survey for Hyde Park on file as RSID003068, and it was witnessed by the county surveyor in 1995. The stone was accepted on every subsequent survey on file for this corner.

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND: *Include, search area or areas, search procedure, etc.*

Date of Field work/Search: 03/23/2018 *By:* R.Oser & E.Smithram *Monument Found:* Cut limestone with "+" *BTs or Reference Objects Found:* Found one old tie from 1995 Monument Record and no original bearing trees *Project #:* T08NR01W-09-10 *Field Book:* 51/51 *Notes:* We tested the stone with hydrochloric acid to confirm the presence of carbonate materials.

OTHER EVIDENCE: *Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.*

The monument is in line with old woven wire fence to the west and t-post line stakes to the north. A U-channel post was found 1.0' east with a Monroe County "PROTECT NEARBY SURVEY MARKER" sign attached 3.2' above grade.

MONUMENT PRESERVATION: *Describe work done to preserve existing monument.*

Three new witnesses were taken.

THEORY OF LOCATION: *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us


Page 3 of 4

MONUMENT RECORD

Corner ID: **Per_Q07**

Quarter Corner

Sections 10 & 11- T08N-R01W, 2nd P.M.
Perry Township, Monroe County, Indiana

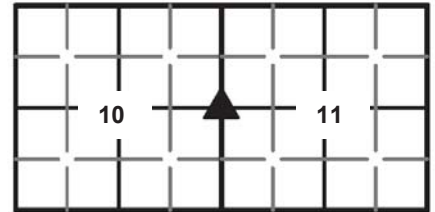

The stone was accepted with no associated uncertainty.

GEODETIC COORDINATES: *Northing:* 1419148.0', *Easting:* 3118484.5'

BASIS OF GEODETIC COORDINATES: The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83_NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Distances obtained with GPS have not been adjusted to ground. Coordinate data was collected with a Javad Triumph LS Network Rover.

This document is not complete without the associated Corner Perpetuation plat and report of survey for Section 10-T8N-R1W by Rachel Oser of the Monroe County Surveyor's Office dated 09/16/2019 and recorded as Instrument Number 2019013499 in the office of the Monroe County Recorder.

CERTIFICATIONS:



Date: September 16, 2019
Rachel Oser, State of Indiana
PS No.21100022



Date: September 12, 2019
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review
Board on September 10, 2019



MONUMENT RECORD

Corner I.D. #

Q-7


STATE OF INDIANA - COUNTY OF MONROE

Section Eleven (11), Township 8 North, Range 1 West

Monument Description & Remarks: Found Limestone Stone w/faint "X" at West
1/4 corner of section. Stone was loose in ground; firmed up and set survey
marker sign & post. Wire woven fence to West & South of Stone.

Recovery Tie Drawing

Note: Stone measures 0.4' x 0.4' x 1.0' out of ground.

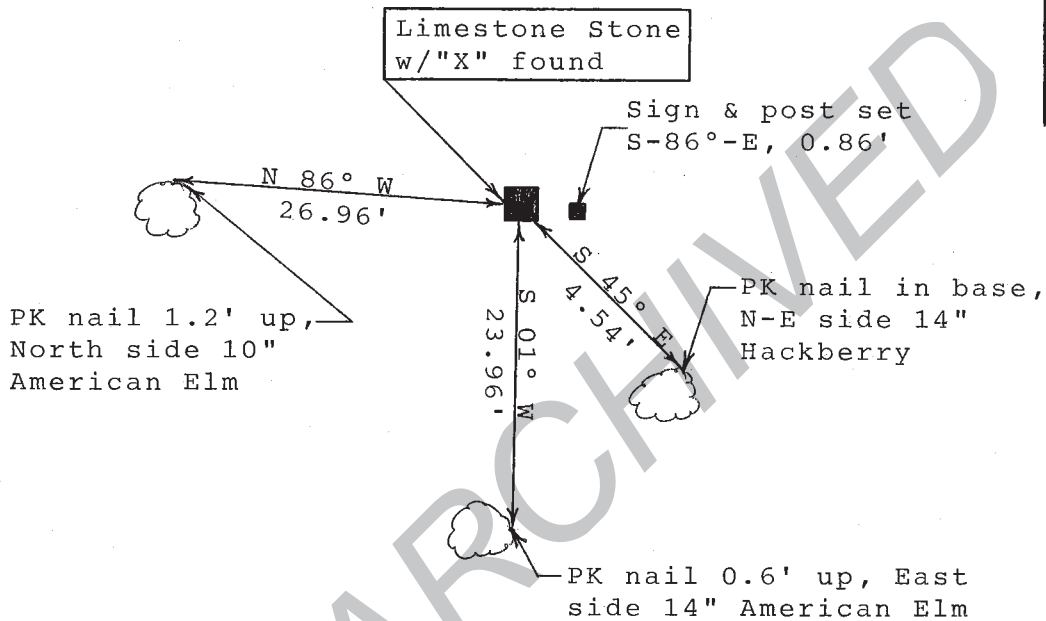

State of Indiana
County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify
that this document was prepared under my direction in
accordance with the provisions of Section 17-3-64-4
through 17-3-64-8 of the Indiana Code, being Acts of 1965,
Chapter 319; and the above data is given under my hand and
seal this 12th day of May, 19 95 A.D.

Space
Reserved For
Recording
Officer

Indiana Registered Land Surveyor No. _____ or

Office of Monroe County Surveyor

United States Government Agency

Monroe County Surveyor

Title

Field Book:

95-01

Page:

39